

A JOHNSON CONTROLS COMPANY Unitary Products Group 5005 York Drive Norman, OK 73069 1/877-874-7378

SERVICE INFORMATION

YS-067-06

Date: August 25, 2006

To: All York Branches All York Regional Managers All York Service Managers All Field Service Supervisors

Subject: Models CMB02411, CMB03011, CZB01811, CZB02411, CZB03011, CZB03611, CZE06011 With Condenser Fan Motor Wired Wrong.

Through the product report system it has been brought to our attention that there have been a number of units assembled with the black motor lead of the condenser fan motor attached to the line side of the contactor instead of the load side of the contactor. If the black motor lead is attached to the line side of the contactor and high voltage is applied to the unit it will result in the fan motor running continuously.

We recommend forwarding this Service Letter to your contractors, and advising them to pay particularly close attention to outdoor fan motors operating continuously during equipment startup. . If units are found to be wired incorrectly during the start up instruct them to wire the fan motor according to the wiring diagram on the unit by moving the black lead from the condenser fan motor from the line side of the contactor to the load side of the contactor.

This problem should normally be detected as part of the start up and check out of the unit.

There will be a ¹/₂ hour labor allowance for those units that are found to be wired incorrectly and have to be rewired at start up.

Note: Please reference the service Letter number when submitting claims for repair.

We apologize for any inconvenience this may have caused you or your customers.

Sincerely, Mike Bass

Darrell Allen

Mike Bass **Field Service Supervisor**

Darrell Allen **Quality Supervisor**

W0E6377833 to W0G5431470

<u>Unit</u> Model

CZE06011

Unit Model	Suspected Serial Number Range		
CMB02411 CMB03011	W0D6158513 W0D6159185		
CZB01811 CZB02411 CZB03011 CZB03611	W0D6184222 W0D6189300	to to	W0F6500688 W0G5601729 W0G6604553 W0G6604681